

5734



MECHANO-ELECTRONIC TRANSDUCER

OPERATING PRINCIPLES

The plate shaft extends through the center of a thin metal diaphragm. Angular displacement of the plate shaft changes the distance between the fixed grid and the plate and results in a change in the plate current. The plane of deflection of the plate shaft coincides with the plane through terminal No.5 and the axis of the tube.

The part of the plate shaft within the tube has a minimum free cantilever resonance of 12000 cycles per second permitting, with suitable mechanical coupling to the external end of the plate shaft, measurements of vibration up to 12000 cycles per second.

OPERATING NOTES

The 5734 may be mounted by means of a supporting clamp which should firmly grip the metal shell of the tube within the designated clamping space indicated on the Outline Drawing. It is essential, however, that the pressure exerted on the shell by the clamp be held to a minimum to prevent possible fracture of the seals.

Under no circumstances should the plate shaft be displaced from its normal position by more than 0.5 degree. A larger displacement of the plate shaft will distort the flexible diaphragm and may damage the tube electrodes.

A non-corrosive flux must be used in soldering the actuating stylus to the plate shaft. Unless this precaution is observed, the plate shaft and the diaphragm will be damaged.

NOV. 15, 1948

TUBE DEPARTMENT
RADIO CORPORATION OF AMERICA, HARRISON, NEW JERSEY


TENTATIVE DATA



5734

5734

MECHANO-ELECTRONIC TRANSDUCER

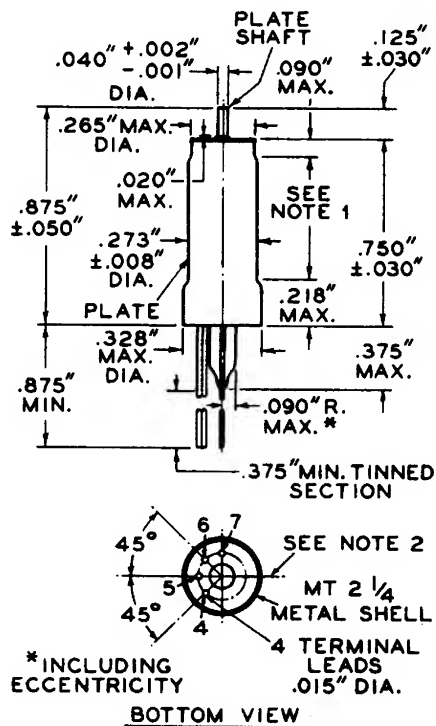

NOTE 1: TUBE SUPPORTING CLAMP ON METAL SHELL MUST BE WITHIN THIS SPACE, AND SHOULD BE FASTENED ONLY TIGHT ENOUGH TO INSURE GOOD CONTACT FOR THE PLATE CONNECTION.

NOTE 2: THE PLANE OF DEFLECTION OF THE PLATE SHAFT WILL COINCIDE WITH THE PLANE THROUGH TERMINAL LEAD No. 5 AND THE AXIS OF THE TUBE.

92CS-7036

NOV. 15, 1948

TUBE DEPARTMENT
RADIO CORPORATION OF AMERICA, HARRISON, NEW JERSEY


CE-7036

5734



5734

AVERAGE CHARACTERISTIC

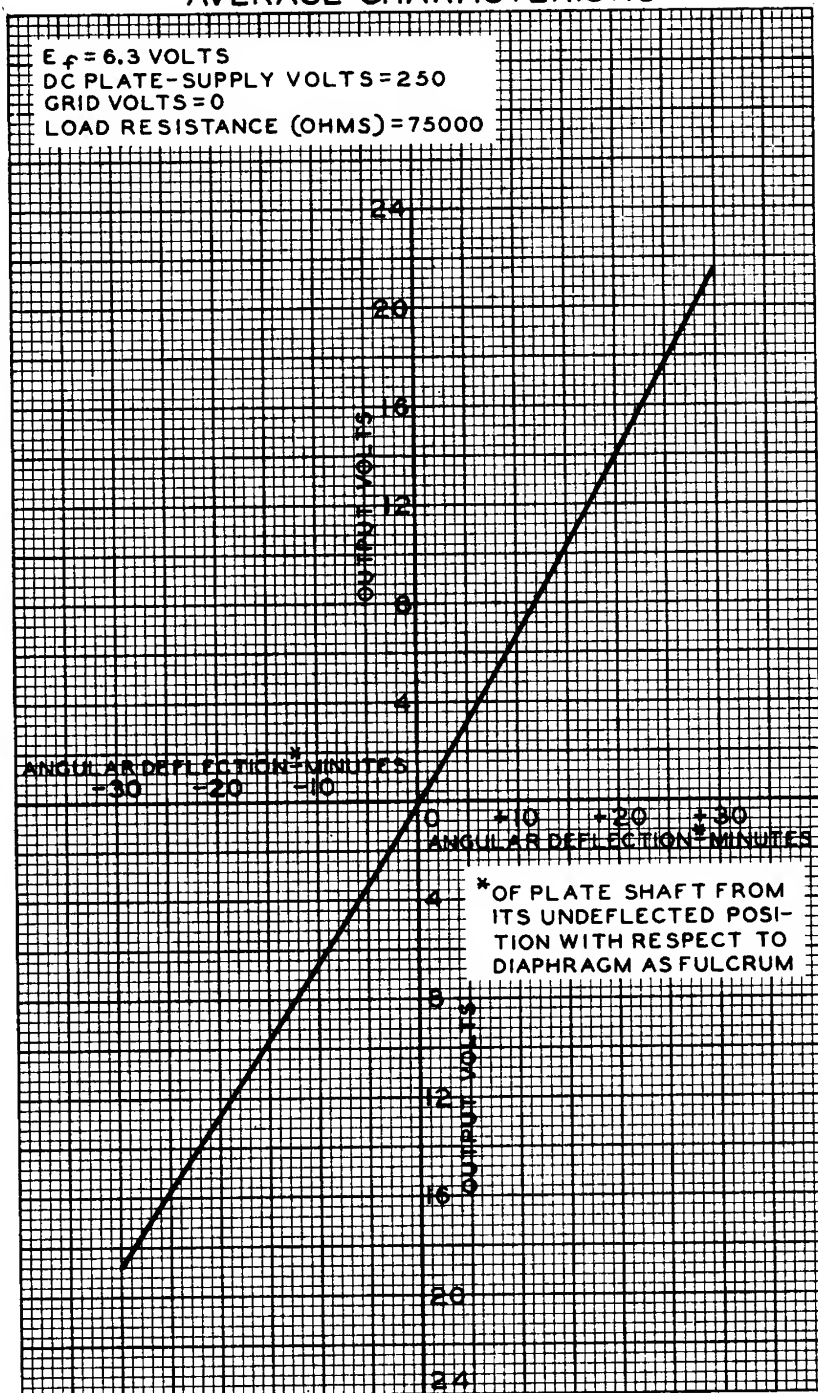

AUG. 13, 1948

TUBE DEPARTMENT
RADIO CORPORATION OF AMERICA, HARRISON, NEW JERSEY


92CM-7055



5734

5734

AVERAGE CHARACTERISTICS

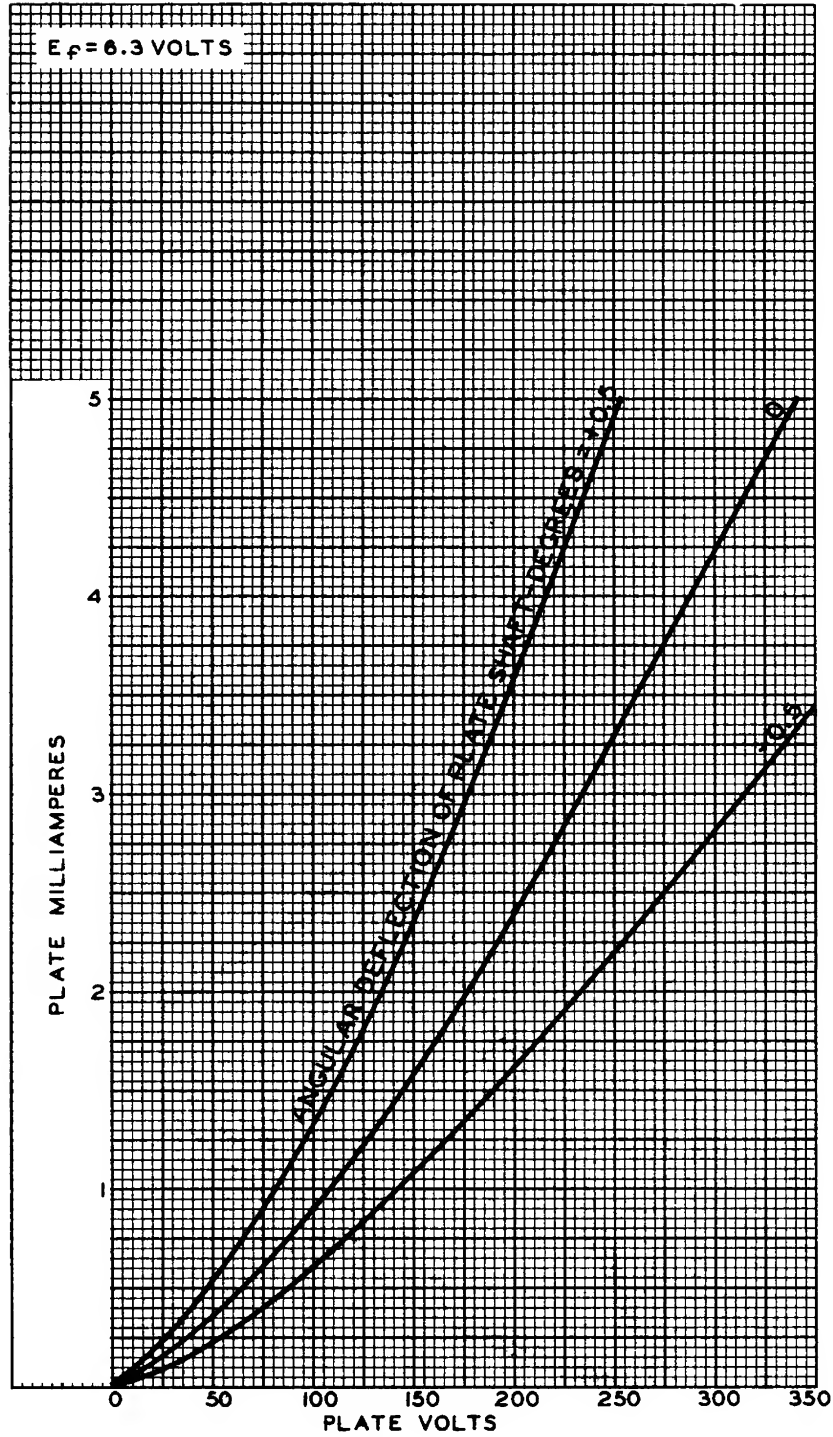

AUG. 17, 1948

TUBE DEPARTMENT
RADIO CORPORATION OF AMERICA, HARRISON, NEW JERSEY


92CM-7059

5734



5734

AVERAGE CHARACTERISTICS

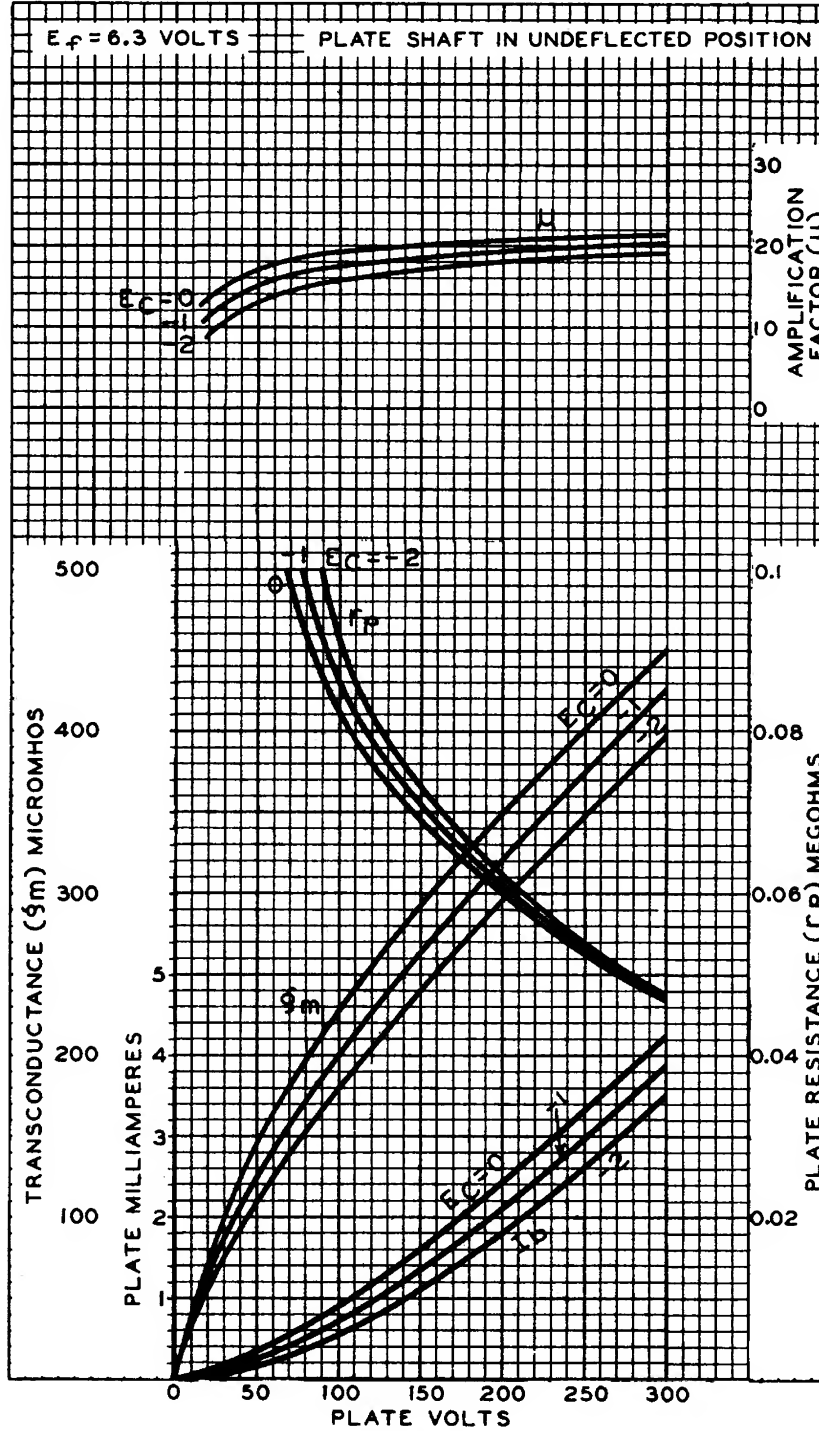

AUG. 17, 1948

TUBE DEPARTMENT
RADIO CORPORATION OF AMERICA, HARRISON, NEW JERSEY

92CM-7057